



!! URGENT !!

Date: 1 September 2023

Subject: Hernandarias, Paraguay
Itaipu Intl (SGIB)
NDB Rwy 03
NDB Rwy 21
Cycle 2308 & 2309

Procedure coding incorrect

Jeppesen NavData for cycle 2308, effective 10 August 2023 and cycle 2309, effective 7 September 2023, contains incorrect data for Itaipu Intl; Hernandarias, Paraguay (SGIB).

- **NDB Rwy 03** – final approach course should read **035°**. Approach transition outbound course should read **193°**. Holding bearings should read **013°/193°**.
- **NDB Rwy 21** – final approach course should read **219°**. Approach transition outbound course should read **019°**. Holding bearings should read **019°/199°**.

WE STRONGLY URGE YOU TO MAKE THIS INFORMATION AVAILABLE TO APPROPRIATE CREW MEMBERS OR CUSTOMERS IMMEDIATELY!

Revised coding will appear in Jeppesen NavData for cycle 2310, effective 5 October 2023. Until then an entry will appear in the NavData Change Notices and this Alert will be posted on the Jeppesen Web site: [Notices and Alerts](#).

If you have questions concerning this NavData Alert, please contact Jeppesen Technical Support at:
+1-303-328-4445 (Western Hemisphere)
+49 610 250 8175 (Eastern Hemisphere)
E-mail: navdatasupport@boeing.com

NavData Alerts are published to advise users of significant issues in Jeppesen navigation data which may affect flight operations or safety. Different avionics equipment and computer systems use and display NavData and data derived from NavData differently. End NavData users should consult with their Avionics Provider for definitive information on whether their system is affected by this Alert.