



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

NAVBLUE Reference: 2605-010

Notification Published date: 06-05-2026

Product: Navigation

Database Type:

Please note that the following information has not been incorporated into NAVBLUE databases for cycle **2605**

The below information is under state query and has been omitted from NAVBLUE databases until the query has been resolved.

Source: Sudan AIRAC AIP Amd 01/22

NOT IN NAVBLUE DATABASES:

Changes to the direction of the segment KAFIA-ALMAM on airway A410 due to an outstanding state query

is awaiting state information clarification.

Source: South Korea (RKPC) AIRAC AMD 06-24

NOT IN NAVBLUE DATABASES:

LPV Minima and the Path Point have not been included for RNP Y RWY 07 and RNP Y RWY 25 approaches.

is awaiting state information clarification.

Source: Canada (CYAZ) AIRAC AMD 44/24

NOT IN NAVBLUE DATABASES:

RNAV (GNSS) RWY 16 approach has not been added to NAVBLUE databases due to an issue with the CRC value (FAS Data Block).

is awaiting state information clarification.

Source: Japan (RJOI) AIP AMD 14/25

NOT IN NAVBLUE DATABASES:



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

RJOI RNAV (RNP) RWY 20 Approach has not been included in NAVBLUE databases due to the unavailability of the waypoint coordinates for IPMER, GURTA, LOBRY, WK001, WK002, SAGPA, WK003, WK004 and PPOPS. The relevant authorities have been contacted.

is awaiting state information clarification.

Source: Bolivia (SLCB) AIRAC AIP Supplement A28/25

NOT IN NAVBLUE DATABASES:

Due to the unavailability of glide slope information the new ILS X RWY32 approach procedure has not been added to NAVBLUE databases.

is awaiting state information clarification.

Source: Turkey (LTCG) AIP 231228

NOT IN NAVBLUE DATABASES:

The following SIDs have not been included in NAVBLUE databases due to insufficient state information relating to the arc radials.

BAVT1M
BAVT1U
MILQ1U
PIXA1M
PIXA1U

is awaiting state information clarification.

Source: United Kingdom (EGVA, EGUL & EGUN) MIL AIRAC AIP AMD 01/26

NOT IN NAVBLUE DATABASES:

The following procedures have not been added to NAVBLUE databases due to missing waypoint coordinates from the state publication.

FAIRFORD (EGVA)

Approaches:

HI-ILS or LOC/DME RWY 09
HI-ILS or LOC/DME RWY 27
HI-TACAN RWY 09
HI-TACAN RWY 27

SID:

MAXOB 2A
MAXOB 2B



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

LAKENHEATH (EGUL)

Approaches

HI/LO ILS Y or LOC RWY 05

HI/LO ILS Y or LOC RWY 23

HI/LO TACAN RWY 05

HI/LO TACAN RWY 23

ILS Z or LOC Z RWY 05

ILS Z or LOC Z RWY 23

RNP RWY 05

RNP RWY 23

TACAN A

SID:

AXHOK 2

TIDPU 3

IPKOP 3

MILDENHALL (EGUN)

Approaches:

ILS or LOC RWY10

RNP RWY10

RNP RWY28

TACAN RWY10

is awaiting state information clarification.

Source: China (ZGGG) AIP Supplement 08/26

NOT IN NAVBLUE DATABASES:

Due to a state query regarding suspension of procedures from AIP SUPP 08/28 publication the following procedures have not be removed:

SID - BOVMA1, LMN1, AGVIL1, MIKIP1, BOVMA2, LMN2, AGVIL2, MIKIP2.

STAR - IDUMA1, IDUMA2.

is awaiting state information clarification.

Source: USA (KDAL) TL 07/26

NOT IN NAVBLUE DATABASES:

Due to duplicated Path Point IDs in the data blocks of procedure RNAV (GPS) Y RWY 13L and RNAV (GPS) Y RWY 13R conflicting with Path Point IDs in existing publications of procedure RNAV (GPS) Z RWY 13R and RNAV (GPS) Z RWY 13L, the following procedures have been added to the database without LPV minima.



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

IAC RNAV (GPS) Y RWY 13L
IAC RNAV (GPS) Y RWY 13R

is awaiting state information clarification.

Source: Turkey (LTAD) AIRAC AMD 03/26

NOT IN NAVBLUE DATABASES:

Due to discrepancies regarding the updated RWY 11L coordinates, the following approaches have not been updated:

RNP RWY 11L
ILS or LOC Y RWY 11L
ILS or LOC Z RWY 11L

The revised procedures will be published once the work at the airport has been completed.

is awaiting state information clarification.

Source: India AIRAC SUPP 61/26

NOT IN NAVBLUE DATABASES:

Due to discrepancies and outstanding query with the state, VEBU RWY17 coordinates and DTHR have not been updated.

is awaiting state information clarification.

Source: Bolivia AIP AMD 05/26

NOT IN NAVBLUE DATABASES:

Due to an outstanding query with the state, SLOR RWY 19 coordinates and DTHR have not been updated.

is awaiting state information clarification.

Source: Ghana (DGAA) AIRAC AIP AMD 01/26

NOT IN NAVBLUE DATABASES:

The waypoint coordinates for AA150 and AA250 have not been published by the state. These waypoints have not been incorporated into the NAVBLUE databases for the following STAR procedures:



AN AIRBUS COMPANY

OMITTED NOTIFICATION BULLETIN

STAR

EREK3B: Waypoint AA250 has not included in the procedure.

KEMO3B: Waypoint AA150 has not included in the procedure.

is awaiting state information clarification.

Source: Cambodia (VDPP) AIRAC AMD 05/26

NOT IN NAVBLUE DATABASES:

The following approach procedures have been withdrawn and should not be used:

VOR/DME RWY 05

VOR/DME RWY 23

ILS RWY 23

RNP RWY 05

RNP RWY 23

is awaiting state information clarification.