



JEPPesen®

Airport Moving Map Alert

!! URGENT !!

Date: 24 September 2026

Subject: Almaty, Kazakhstan
Almaty (UAAA)
Cycle 2609 and 2610

Apron 1 layout incorrect

Jeppesen Airport Moving Map and A816 formatted data for cycle 2609, effective 03 September 2026, and for cycle 2610, effective 01 October 2026 contain incorrect data for Almaty; Almaty, Kazakhstan (UAAA). Kazakhstan AIRAC AIP SUP 008/2026, published and effective 18 September 2026, introducing the commissioning of new stands and taxilanes on deicing pad (Apron 1), was received after 2609 and 2610 AIRAC cycle data processing due dates.

As a result, the following changes are not reflected in cycle 2609 and 2610 data:

- Parking Stands 105, 107, 107A, 107B, 108A, 108, 108B are added
- Taxilanes A6, B1, B2, are added
- Taxilane A5 (between Taxilane A2 and Parking Stand 106B) is shifted north

**WE STRONGLY URGE YOU TO MAKE THIS INFORMATION AVAILABLE
TO APPROPRIATE CREW MEMBERS IMMEDIATELY!**

Revised data will appear in Jeppesen Airport Moving Map and A816 formatted data for cycle 2611, effective 29 October 2026. Until then this Alert will be posted on the Jeppesen Web site: Notices and Alerts. Please refer to the local NOTAMs and attached Almaty, Kazakhstan (UAAA) 10-8F chart dated 2 OCT 26 for valid information.

If you have questions concerning this Airport Moving Map Alert, please contact Jeppesen Technical Support at:

Support Portal: digitalsuccess.jeppesen.com

Airport Moving Map Alerts are published to advise users of significant issues in Jeppesen Airport Moving Map and A816 data which may affect aircraft ground operations. These Alerts are distributed to affected Airport Moving Map users. Different avionics equipment and computer systems use and display Airport Moving Map and data derived from A816 differently. End Airport Moving Map and A816 data users should consult with their Service Provider for definitive information on whether their system is affected by this Alert.

UAAA_2609_2610

COMMISSIONING OF NEW STANDS AND TAXILINES ON DEICING PAD (APRON 1) (SUP 008/26)

REFER ALSO TO LATEST NOTAMS


Introduction

The purpose of this chart is to inform operators of the official commissioning of new Acft. stands, 105, 107, 107A, 107B, 108, 108A, 108B, and new taxilanes A5, A6, B1, B2 on the Deicing Pad.

ARRIVAL AND DEPARTURE TAXIING OF ACFT. ON NEW STANDS AND TAXILINES MUST BE GUIDED BY FOLLOW-ME.

Acft stands data

Stand	Coordinates	Acft Cat
105, 107	N43 20.8 E077.01.0	Code E
107A	N43 20.8 E077.01.1	Code C
107B	N43 20.8 E077.01.0	Code C
108	N43 20.8 E077.01.0	Code E
108A	N43 20.8 E077.01.0	Code C
108B	N43 20.8 E077.00.9	Code C

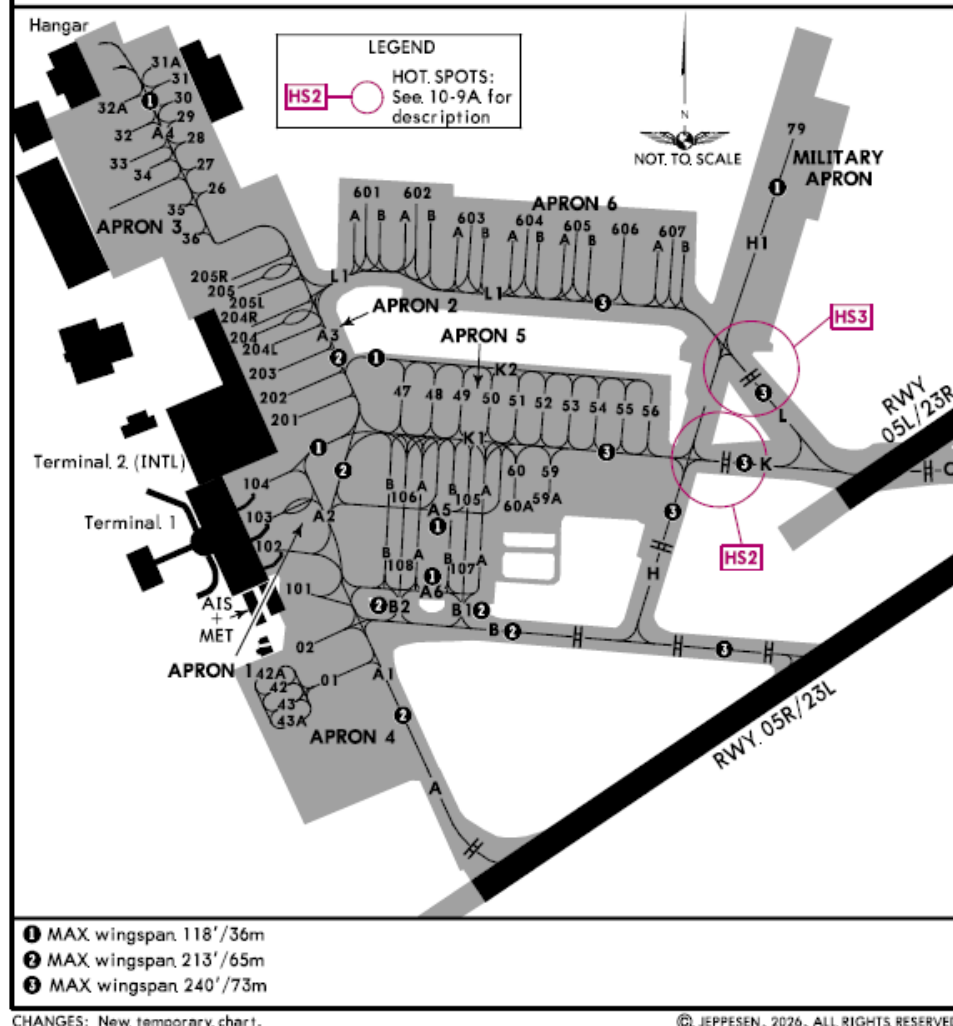

If you have questions concerning this Airport Moving Map Alert, please contact Jeppesen Technical Support at:

Support Portal: digitalsuccess.jeppesen.com

Airport Moving Map Alerts are published to advise users of significant issues in Jeppesen Airport Moving Map and A816 data which may affect aircraft ground operations. These Alerts are distributed to affected Airport Moving Map users. Different avionics equipment and computer systems use and display Airport Moving Map and data derived from A816 differently. End Airport Moving Map and A816 data users should consult with their Service Provider for definitive information on whether their system is affected by this Alert.